


**MONUMENT RECORD**  
Corner ID: **Rich\_Q11**  
**Section Corner**  
Sections 14 & 15- T09N-R02W, 2nd P.M.  
Richland Township, Monroe County, Indiana

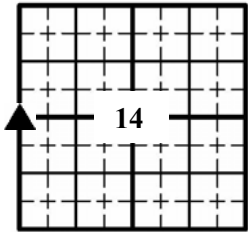

**EXISTING SURVEY HISTORY**

Include as much detail and history of the corner as known at the time of perpetuation.

**ORIGINAL GOVERNMENT SURVEY:**

Year Surveyed: **1816** By: **William Harris**  
Where filed or recorded: **Original Notes Pages 349-350**  
Original monument: **Post**  
Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Distance
<b>Walnut</b>	<b>16"</b>	<b>N 00° E</b>	<b>20 Links</b>
<b>Sugar</b>	<b>17"</b>	<b>S 44° W</b>	<b>32 Links</b>

Notes:

**PERPETUATION RECORD**

**MONUMENT:** Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)  
**Mag Spike with washer stamped "Deckard" set slightly below grade**

**OTHER EVIDENCE:** Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.  
**Mag spike with washer set +/- 11' East of North-South running centerline of Hartstrait Road**

**THEORY OF LOCATION:** Describe the theory of location for acceptance of this monument with reference to the recording information for the survey upon which this record is derived. Said recorded survey shall be certified by the same professional surveyor who certifies this document, shall identify and accept this monument, and shall have been recorded within (3) years of Form submittal.  
**This corner was calculated in a survey performed by Kevin Burton Potter for Pfaff and Oliver dated November 23rd, 1994 per an unrecorded Henry Dorman survey dated 1972/1974. This corner was then set in a survey performed by Douglas R. Curry dated October 21st, 2005, however no monument was recovered at this location at this time. This mag spike was set at the location previously calculated in a survey performed by Andrew E Wilken for Franklin dated September 19th, 2018. This calculated position was later held by Wilken in a survey dated December 16th, 2019 and a survey performed by Eric L. Deckard for Bettler dated September 23rd, 2020.**

**MONUMENT PRESERVATION:** Describe work done to preserve existing monument. Stone mounds should be placed around monuments when stones are readily available. Paint corner stones but not the scribing. A Monroe County "PROTECT NEARBY SURVEY MARKER" sign shall be attached to a steel post when practicable. Note location and relation of corner to sign.  
**A Monroe County "PROTECT NEARBY SURVEY MARKER" sign was placed on the Southwest side of a Sugar Maple to the Northeast of the mag spike**


**GEODETIC COORDINATES:** Northing: **1445442.5**, Easting: **3086470.6**

**BASIS OF GEODETIC COORDINATES:** Describe equipment, date, and personnel used to collect coordinates, datum, epoch, geoid and zone.  
**Coordinates shown hereon were obtained from GPS observations utilizing the Indiana Real-Time Network (INCORS). Indiana West Zone, NAD83(2011) Epoch 2010.0000, State Plane Grid Coordinates, US Survey Feet. Geoid model G2012BU7. Datum NAD83\_NO\_TRANS by Jackson Rogers and Kyle Hazelman on November 30th, 2021.**


**WITNESS MONUMENT TIES:** Describe at least three new BT's and/or witness objects established or work done to preserve existing evidence. The following procedures are provided for guidance. Please utilize professional judgment when choosing witness ties. All ties to BT's should be a magnetic nail and washer (state what kind) set in a hack mark at root crown (less than 12" above ground) perpendicular to center of tree unless otherwise noted. All monuments should be tied to at least three accessories with a minimum of 60° of separation. BTs should be healthy with a minimum DBH of 4". BT description should include tree species, diameter at 4.5' above ground, distance of nail above ground, and description of nail location (e.g.. SE side of root). Note bearing from monument to the center of the BT, distance to the nail. Other survey monuments that were located in the vicinity and their relation to the monument may also be included.

ID	Bearing	Distance	Description
<b>B</b>	<b>N 57° E</b>	<b>21.9'</b>	<b>Mag nail w/ washer set 1' A.G. in the Southwest side of 20" Dia. Sugar Maple</b>
<b>C</b>	<b>S 47° W</b>	<b>36.7'</b>	<b>Mag nail w/ washer set 6" A.G. in Northeast side of 6"x8" Wood Post</b>
<b>D</b>	<b>N 78° W</b>	<b>35.6'</b>	<b>Mag nail w/ washer set 6" A.G. in South side of 6"x8" Wood Post</b>

Notes:

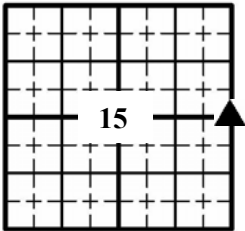

**MONUMENT RECORD**  
Corner ID: **Rich\_Q11**  
**Section Corner**  
Sections 14 & 15- T09N-R02W, 2nd P.M.  
Richland Township, Monroe County, Indiana

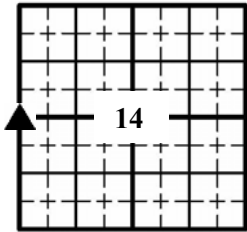

**MONUMENT LOCATION SKETCH:** Optional: Attach a sketch or aerial image. Monument sketch is not required for reimbursement.

**PHOTO IDENTIFIED:** Photograph close up photo of monument and a vicinity photo of the monument that includes the Monroe County “PROTECT NEARBY SURVEY MARKER” sign. Provide photo orientation and date. Additional photos may be included by clicking the “+” button at the end of the horizontal line.  
Photo Date: **November 2021**



Photo Orientation & Description: **Looking East at Q-11**



Photo Orientation & Description: **Looking South at Q-11**

**FIELD PERSONNEL:**

Field Date: **11/30/21** By: **J.R. & K.H.** Project #: **21-157** Field Book: , page: Notes:

**CERTIFICATION:**

Professional Surveyor Name: **Eric L. Deckard**  
Indiana Professional Surveyor No.: **29900012**  
Firm Name: **Deckard Land Surveying**  
Date: **12/03/21**


Signature:




Seal:

**OFFICE USE ONLY**

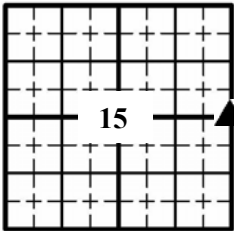

NOTICE TO PROCEED AND MONUMENT RECORD FORM ISSUED TO:	
Offeror Name: <b>Eric L. Deckard</b>	Firm Name: <b>Deckard Land Surveying, LLC</b>



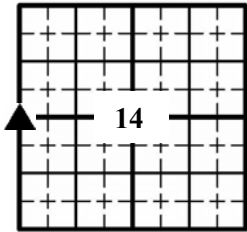

**MONUMENT RECORD**  
Corner ID: **Rich\_Q11**  
**Section Corner**  
Sections 14 & 15- T09N-R02W, 2nd P.M.  
Richland Township, Monroe County, Indiana



Phone:	(812 )961-0235	Email:	Ericdeckard1@msn.com
Corner Classification: Section Corner		Corner Coordinate Status: Perpetuated	
Issue Date:	7/12/22	Form Due Date:	7/21/22
		Form Receipt Date:	7/21/2022

<b>COUNTY SURVEYOR APPROVAL:</b>  <input checked="" type="checkbox"/> Yes, Signature:   <input type="checkbox"/> No, reasons for denial	Date: 8/23/22	Seal: 
---	---------------	--

<b>SURVEYOR REVIEW BOARD APPROVAL:</b>  <input checked="" type="checkbox"/> Yes, Signature:   <input type="checkbox"/> No, reasons for denial	Date: 8/23/22	Seal: 
---	---------------	--